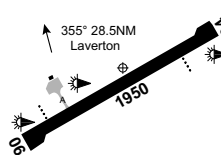


**SUNRISE DAM****ELEV 1350****AVFAX CODE 6109**

WA

290554S

1222719E

UTC +8

VAR 1 DEG E

YSRD

CERT

AD OPR Anglogold Ashanti Australia Ltd - GPO Box F377, Perth, WA, 6001. Email: inflightess@anglogoldashanti.com. PH 08 9080 3765 (BH). ARO 0437 413 119 (H24).

**REMARKS**

Restricted OPS: PPR from AD OPR.

**HANDLING SERVICES AND FACILITIES**

JET A1 private installation. Contact National Jet Express, PH 08 8154 7444.

Email: rsgroundops@nje.aero.

**AERODROME OBSTACLES**

IWI:

- BRG 075 DEG MAG 575M FM ARP. Infringes TNS by 8FT.
- BRG 240 DEG MAG 805M FM ARP. Infringes TNS by 8FT.

**PHYSICAL CHARACTERISTICS**

06/24 059 64a PCN 25 /F /A /1075 (156PSI) /T

WID 30 RWS 150

**AERODROME AND APPROACH LIGHTING**

RWY 06/24 LIRL PAL 120.25

RWY 06/24 PAPI PAL 120.25 3.0 DEG49FT

RWY edge light spacing: 59M.

**OTHER LIGHTING**

TWY LGT: Blue edge.

**ATS AND AERODROME COMMUNICATION FACILITIES**

FIA MELBOURNE CENTRE

118.4 3,500FT

**LOCAL TRAFFIC REGULATIONS**

RWY 06/24 - RWY end turning nodes - all turns must be MNM speed MAX RAD.

**FLIGHT PROCEDURES**

ACFT to avoid flying over mine pit.

**CTAF - AFRU 126.8**

AFRU signal not AVBL on ground Laverton, Murrin Murrin or Sunrise Dam. AFRU located at Leonora.

**ADDITIONAL INFORMATION**

- Bird Hazard in VCY of AD (falcons or hawks).
- Animal hazard (kangaroos). ARO will conduct additional RWY inspection prior to scheduled ACFT OPS.
- Seasonal wetlands may be present at western end of RWY, ducks, swans and birds of prey maybe in VCY.

**CHARTS RELATED TO THE AERODROME**

- WAC 3352.
- Also refer to AIP Departure and Approach Procedures.